

TANNOY V8/VX8/VXP8 and V12/VX12/VXP12 Driver Compatibility




Service Support

Part Number A09-CAB00-00000 is a compatible replacement driver for the TANNOY V8, VX8 and VXP8.


Part Number A09-CA900-00000 is a compatible replacement driver for the TANNOY V12, VX12 and VXP12.

In order for the drivers to be compatible, the terminals of the HF Diaphragm must be swapped during the installation, following the procedure below:

1. Connect the Green wire (Negative) to the positive terminal of the diaphragm, as shown below.
2. Replace the connector at the end of the Yellow wire with one that is 4.8 mm (the correct size to match the negative terminal).
3. Connect the Yellow wire (Positive) to the negative terminal of the diaphragm, as shown below.
4. The wires for the driver will remain the same.

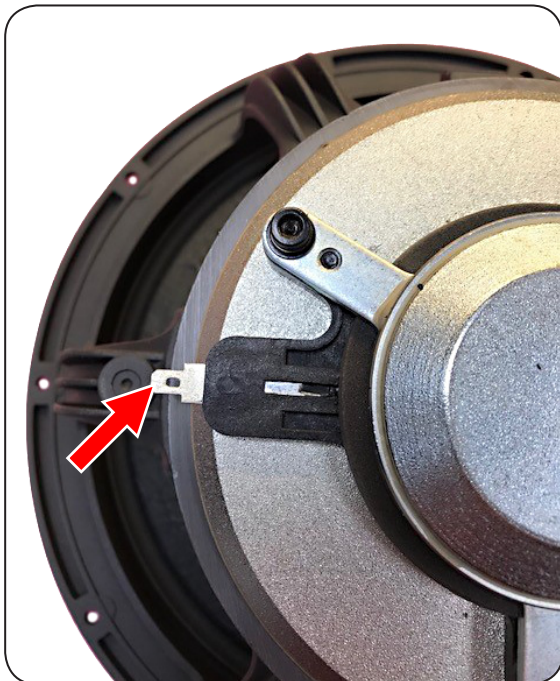

Yellow wire (Positive) to be connected to
negative terminal

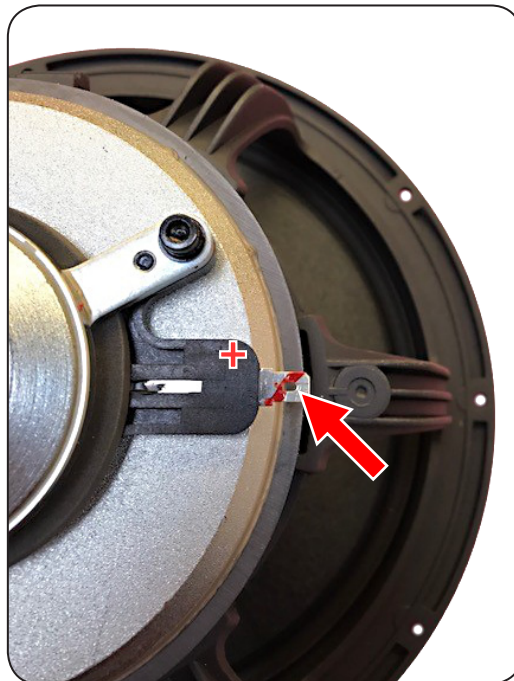

Green wire (Negative) to be connected to the
positive terminal

MUSIC Tribe accepts no liability for any loss which may be suffered by any person who relies either wholly or in part upon any description, photograph, or statement contained herein. Technical specifications, appearances and other information are subject to change without notice. All trademarks are the property of their respective owners. MIDAS, KLARK TEKNIK, LAB GRUPPEN, LAKE, TANNOY, TURBOSOUND, TC ELECTRONIC, TC HELICON, BEHRINGER, BUGERA and COOLAUDIO are trademarks or registered trademarks of MUSIC Tribe Global Brands Ltd. © MUSIC Tribe Global Brands Ltd. 2018 All rights reserved.

Confidential, for internal use only. Not to be reproduced.

985-40000-00768 Rev.B
2018-01-09

TANNOY